
■Specifications


| Classification | | | Indicator | | Single preset output type | Dual preset output type | |
|-----------------------|----------------|--------------------------------|--|--|---|--|--|
| | | DC, AC Voltage | M4Y-DV- □ M4Y-AV □ - □ M5W-DV- □ M5W-AV- □ | M4W-DV- M4W-AV - M4M-DV- M4M-AV - | M4W1P-DV- M4W1P-AV | M4W2P-DV- M4W2P-AV M4M2P-DV- M4M2P-AV M4M2 | |
| Measurement | | DC, AC Ampere | M4Y-DA- M4Y-AA M5W-DA- M5W-AA- | M4W-DA- | M4W1P-DA- M4W1P-AA | M4W2P-DA- M4W2P-AA M4W2P-DA- M4W2P-DA- M4W2P-AA M4W2P-AA M4W2P-AA | |
| | | C power -10VDC) | M4Y-W- □ M5W-W- □ | M4W-W- □ M4M-W- □ | M4W1P−W− □ M4M1P−W− □ | M4W2P-W- □ M4M2P-W- □ | |
| | (0 | m, speed -10VDC) -10VAC) | M4Y-T - | M4W-T | M4W1P-T | M4W2P-T □ - □ M4W2P-S □ - □ M4M2P-T- □ M4M2P-S- □ | |
| | | wer factor C4-20mA) | - | M4W-P (Refer to E-45) | - | _ | |
| Max. | . allov | vable input | 150% for each input specification(At 400VAC:120%) | | | | |
| Power supply | | | 100-240VAC 50/60Hz ★5VDC (Except for M5W) ★24-70VDC | | 110/220VAC 50/60Hz ★24-70VDC ★100-240VAC 50/60Hz | | |
| Allow | vable | voltage range | 90 ~ 110% of rated voltage | | | | |
| Pow | er cor | nsumption | DC: 2W, AC: 4VA DC: 3W, AC: 5VA | | | | |
| Display method | | | 7 Segment LED Display | | | | |
| Character height | | height | M4Y, M4W, M5W: 14.2mm / M4W1P, M4W2P: 10.16mm / M4M1P, M4M2P: 10mm | | | | |
| Display accuracy | | ccuracy | DC : F · S $\pm 0.2\%$ rdg ± 1 digit AC : F · S $\pm 0.5\%$ rdg ± 1 digit | | | | |
| Sampling period | | period | 300ms | | | | |
| A/D conversion method | | rsion method | Dual slope integral method | | | | |
| Response time | | | 2sec.(0 to Max.) | | | | |
| Display frequency | | equency | 2.5 times/sec | | | | |
| Contact capacity | | apacity | Relay conatact out: 250VAC 3A 1c | | | Relay conatact output: 250VAC 3A 1c×2 | |
| Insulation resistance | | resistance | Min. 100MΩ (at 500VDC mega) | | | | |
| Dielectric strength | | strength | 2000VAC 50/60Hz for 1 minute | | | | |
| Noise strength | | ngth | ±1kV the square wave noise(pulse width:1 μ s) by the noise simulator | | | | |
| Vibra | ation | Mechanical | 0.75mm amplitude at frequency of 10 ~ 55Hz in each of X, Y, Z directions for 1 hour | | | | |
| | | Malfunction | | | equency of 10 ~ 55Hz in each of X, Y, Z directions for 10 minutes | | |
| Sho | ock Mechanical | | 300m/s² (30G) in X, Y, Z directions for 3 times | | | | |
| 0110 | - 0.1 | Malfunction | | 100m/s ² (10G) in X, Y | , Z directions for 3 times | | |
| Re | · · | Mechanical | | | Min. 10, | | |
| life c | 1 | | Min. 100,000 (250VAC 3A resistive load) | | | | |
| Ambient temperature | | | -10 ~ +50 °C (at non-freezing status) | | | | |
| Storage temperature | | | -20 ~ +60℃ (at non-freezing status) | | | | |
| Ambient humidity | | numidity | 35 ~ 85%RH | | | | |
| Unit weigl | | nt | M4Y:Approx. 170g M5W:Approx. 317g | M4W:Approx. 317g M4M:Approx. 401g | M4W1P:Approx. 408g M4M1P:Approx. 467g | M4W2P:Approx. 424g M4M2P:Approx. 496g | |


E-35 Autonics

Dimensions



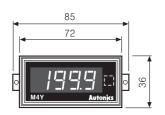

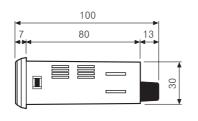

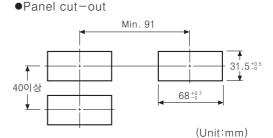

※Unit will be displayed in □ of front panel.

Counter

(B) Timer

(C) Temp. controller

(D) Power controller

●M4W








●M4W2P



●M5W



●Panel cut-out

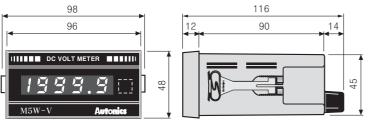

Min. 116

45^{+0.6}

520|&

92^{+0.8}

(Unit:mm)

★Unit will be displayed in [] of front panel.

●M4M



•M4M1P




●M4M2P

67



●Panel cut-out

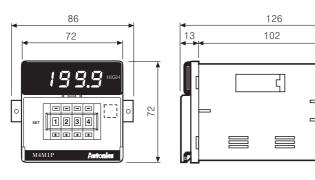

91이상

Min. 91

※Unit will be displayed in ☐ of front panel.

(E) Panel meter

(F) Tacho/ Speed/ Pulse meter

(G) Display unit

(H) Sensor controller

(I) Switching power supply

(J) Proximity sensor

(K) Photo electric sensor

(L) Pressure sensor

(M) Rotary encoder

(N) Stepping motor & Driver & Controller

(O) Graphic panel

(P) Field network device


68 +0.7

68 +0.7

(Unit:mm)

(Q) Production stoppage models & replacement

Connections

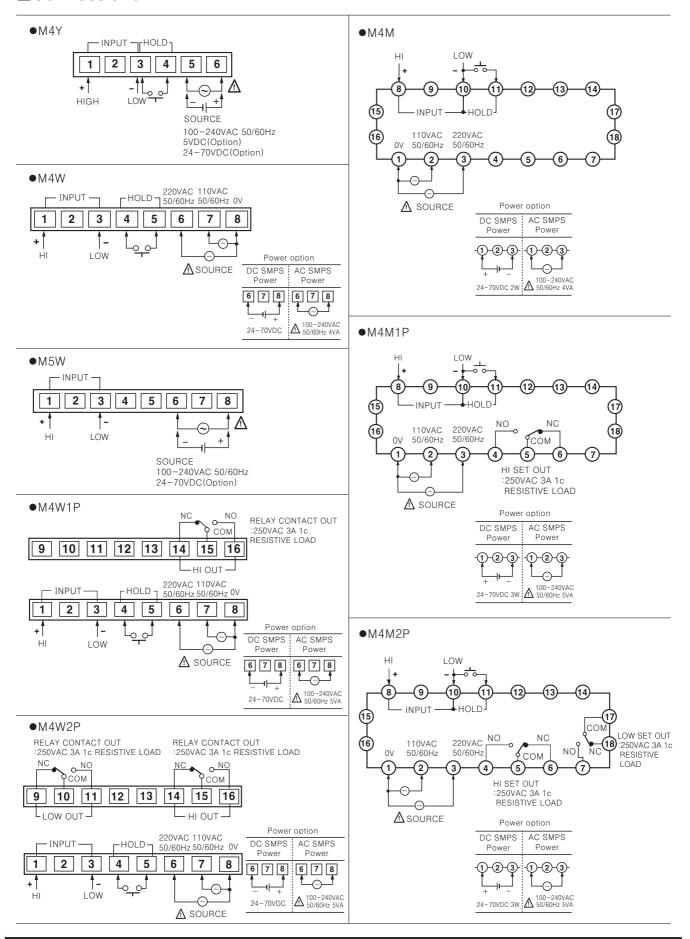

E-37 Autonics

DIN W72×H36mm, W96×H48mm, W72×H72mm Digital panel meter for measuring voltage


■ Features

- •Max. display: 19999 (M5W), 1999 (Others)
- Auto zero function or Hold function (Except for M5W)
- •RMS/AVG value selection function(AC Voltage)
- •7 Segment LED Display
- •Case size by DIN specification
- •Indicator, Single preset output type, Dual preset output type

Please read "Caution for your safety" in operation manual before using.



Ordering information

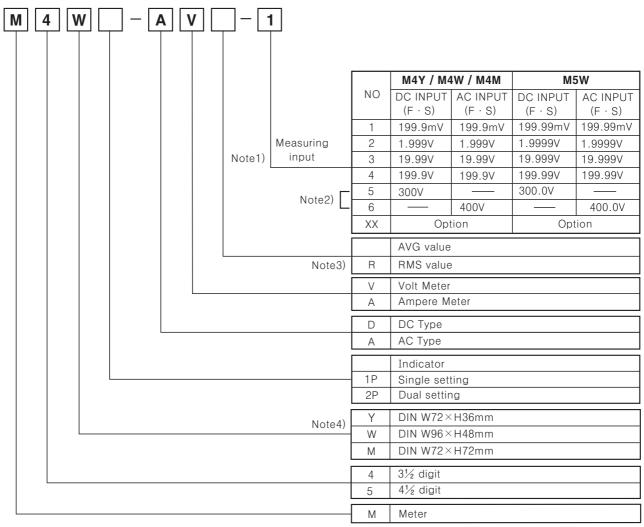

Note1) Measuring input and display are 1:1.

Note2) Available input can be direct connection if under 300VDC, 400VAC.

Note3) RMS only applies to AC measuring type. Do not enter "R" with DC model.

Note4) M4Y, M5W are indicator.

(A) Counter

(B) Timer

(C) Temp.

(D) Power controller

(E) Panel meter

(F) Tacho/ Speed/ Pulse meter

(G) Display unit

(H) Sensor controller

Switching power supply

(J) Proximity sensor

(K) Photo electric sensor

(L) Pressure

(M) Rotary encoder

(N) Stepping motor & Driver & Controller


(O) Graphic panel

(P) Field network device


(Q) Production stoppage models & replacement

The application of connections

OMeasuring DC voltage

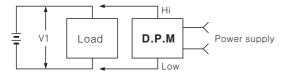

(Fig. 1) Measuring lower than 300VDC of measurement voltage (V1)

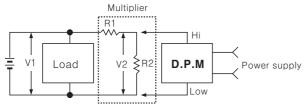

(Fig. 2) Measuring higher than 300VDC of measurement voltage


*When measuring voltage is higher than 300VDC, please select R1 and R2 with multiplying resistance on the external to make V2 less than max. measure ment voltage.

$$V2 = \frac{R2}{R1+R2} \times V1 \qquad R1 \ \rangle \ R2$$


Ex)Ordering D.P.M for measuring 1000VDC

As above Fig. 2, select the R1 value to make 300VDC on R2.

(Generally R1 value will be higher than R2 value.) Order the D.P.M indicating 1000V for 300VDC.

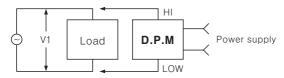

(Fig. 3) Measuring lower than 400VAC of measurement voltage (V1)

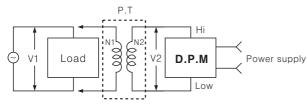

(Fig. 4) Measuring higher than 400VAC of measurement voltage (V1)

*When measuring voltage is higher than 400VAC, please use the P.T on the external. (V2 voltage must be lower than max. measurement voltage)

$$V2 = \frac{N2}{N1} \times V1$$

Ex)Ordering D.P.M for measuring 1000VAC Select the P.T having 1000VAC of 1st part voltage and 220VAC of 2nd part voltage and order the D.P.M indicating 1000V for 220VAC.

Proper usage

- •Please notice the product customized by requirement cannot be replaced.
- •If it displays arbitrary number even though the power is ON, please remove the input signal and check whether it displays "0000" after short the measurement terminal.

(Checking Auto zero function)

If it does not display "0000", please connect to our A/S center.

Note)M5W Series does not have Auto zero function.

•If it indicates "1999" or "-1999" during input signal is ON, please turn OFF the power and check the connection condition.

It is because the input signal is too low or high. Note) M5W Series indicates "19999" or "-19999".

•The specification of measurement input, which is indicated in ordering information, is a standard specification, 1:1 of measurement input and process value. When it is an optional specification of AC voltmeter, please mark the specification of P.T after select a model.

*Please notice P.T is not included.

• The D.P.M for measuring AC voltage has both AVG type and RMS type separately.

Because it is produced with AVG type, please mark the model name accurately.

Ex)In case of M4Y, M4W, M4M Series(Include setting type)

The model of RMS type: M4W-AVR-6

The model of AVG type: M4W-AV-6

*The specification will be set by sign "R".

** M5W Series has RMS type only, and it is not indicated "R" on the model name.

•In case of D.P.M for measuring AC voltage, please check if it is AVG type or RMS type when comparison measuring with other company's products.

E-39 Autonics

DIN W72×H36mm, W96×H48mm, W72×H72mm Digital panel meter for measuring ampere

Features


- •Max. display: 19999 (M5W), 1999 (Others)
- Auto zero function or Hold function (Except for M5W)
- •RMS/AVG value selection function (AC Voltage)
- •7 Segment LED Display
- •Case size by DIN specification
- •Indicator, Single preset output type,

Dual preset output type

Please read "Caution for your safety" in operation manual before using.



Ordering information

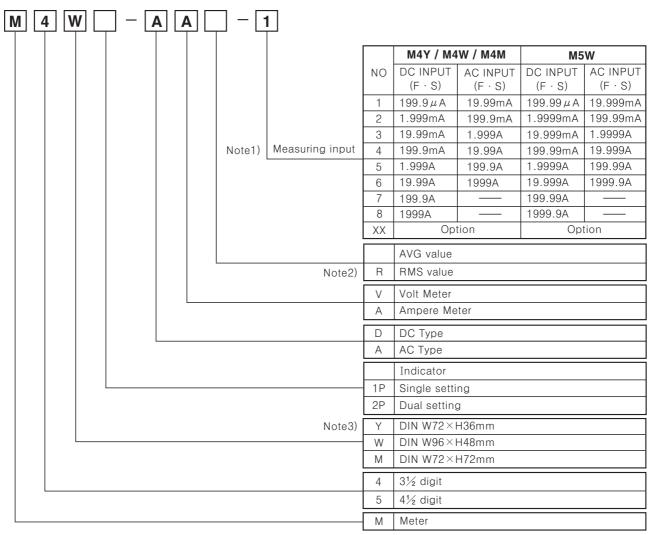

Note1) Measuring input and display is 1:1 for DC INPUT No.1 to 5 and AC INPUT No.1 to 3, DC INPUT No.6 to 8 is used with DC50mV Shunt, AC INPUT No.4 to 6 are used with C.T(Current transformer)

Note2) RMS only applies to AC measuring type. Do not enter "R" with DC model.

Note3) M4Y, M5W are indicator.

Counter

(A)

(B) Timer

(C) Temp.

(D) Power controller

(E) Panel meter

(F) Tacho/ Speed/ Pulse meter

(G) Display unit

(H) Sensor controller

Switching power supply

(J) Proximity sensor

(K) Photo electric sensor

(L) Pressure

(M) Rotary encoder


(N) Stepping motor & Driver & Controller

(O) Graphic panel


(P) Field network device

(Q) Production stoppage models & replacement

Connections

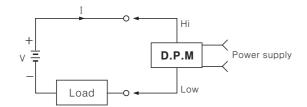


(Fig. 1) Measuring lower than 2ADC of current

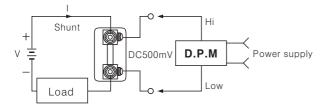

(Fig. 2) Measuring higher than 2ADC of current *Higher than 2ADC is using shunt for measuring current. *Basically the 2nd part of shunt value is DC50mV.

Ex)Ordering D.P.M in case of 10ADC of measuring ampere: Select 10ADC/DC50mV of shunt and DC50mV/10.00ADC of D.P.M.


Measuring AC voltage

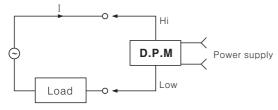

(Fig. 3) Measuring lower than 5AAC of current

Ex)Ordering D.P.M in case of lower than 5AAC of measuring ampere:

Select M4W-AA-XX AC5A/5.00A

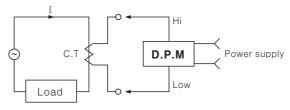

(Fig. 4) Measuring higher than 5AAC of current

* If the current is higher than 5AAC, please use C.T.

Ex)How to order D.P.M in case of 300AAC of measuring ampere: Select 300AAC/5A of C.T and 5AAC/300A of D.P.M.

■ Proper usage

- •Please notice the product customized by requirement cannot be replaced.
- •If it displays arbitrary number even though the power is ON, please remove the input signal and check whether it displays "0000" after short the measurement terminal.

(Checking Auto Zero function)

If it does not display "0000", please connect to our A/S center.

Note) M5W Series does not have Auto zero function.

•If it indicates "1999" or −1999 during input signal is ON, please turn OFF the power and check the connection condition.

It is because the input signal is too low or high. Note)M5W Series indicates "19999" or "-19999".

- •The specification of measurement input, which is indicated in ordering information, is a standard specification, 1:1 of measurement input and process value.
- *Please notice a shunt and C.T are not included.
- •The D.P.M for measuring AC voltage has both AVG type and RMS type separately.

Because it is produced with AVG type, please mark the model name accurately.

Ex)In case of M4Y, M4W, M4M Series(Include setting type)

The model of RMS type: M4W-AAR-5

The model of AVG type: M4W-AA-5

*The specification will be set by sign "R".


- *M5W Series has RMS type only, and it is not indicated "R" on the model name.
- In case of D.P.M for measuring AC voltage, please check if it is AVG type or RMS type when comparison measuring with other company's products.

E-41 Autonics

DIN W72×H36mm, W96×H48mm, W72×H72mm Digital panel meter for measuring power


■ Features

- •Max. display: 19999 (M5W), 1999 (Others)
- Auto Zero function and Hold function (Except for M5W)
- ◆Display the output(0-10VDC) from Power converter.
 (It is available to correspond when output is DC4-20mA, 1-5VDC.)
- •7 Segment LED Display
- •Case size by DIN specification.
- •Indicator, Single preset output type, Dual preset output type

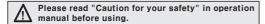




Ordering information

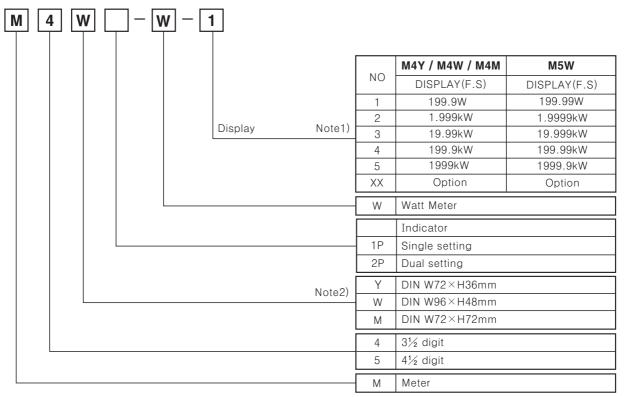

Note1) When output specification of power converter is 0-10VDC, Display value is maximum. Note2) M4Y, M5W are indicator.

*If output specification of Converter or power converter is DC4-20mA or 1-5VDC, please use Scaling Meter.

■Application of connection

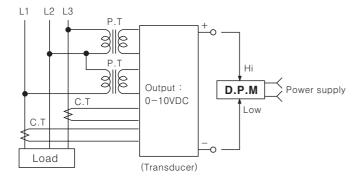

- ●The specification of measuring input indicated in ordering information, is display value output specification is 0-10VDC.
- ●When the output of transducer or converter is DC4-20mA or 1-5VDC, please use Scaling Meter.

(A) Counter

(B) Timer

(C) Temp.

(D) Power controller

(E) Panel meter

(F) Tacho/ Speed/ Pulse meter

(G) Display unit

(H) Sensor controller

Switching power supply

(J) Proximity sensor

(K) Photo electric sensor

(L) Pressure sensor

(M) Rotary encoder

(N) Stepping motor & Driver & Controller

(O) Graphic panel


(P) Field network device

(Q) Production stoppage models & replacement

DIN W72×H36mm, W96×H48mm, W72×H72mm Digital panel meter for measuring Revolution/Speed


■ Features

- •Max. display: 19999 (M5W), 1999 (Others)
- •Auto Zero function or Hold function (Except for M5W)
- •RMS/AVG value selection function (AC Voltage)
- •7 Segment LED Display
- •Case size by DIN specification
- Indicator, Single preset output type,
 Dual preset output type

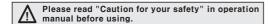




Ordering information

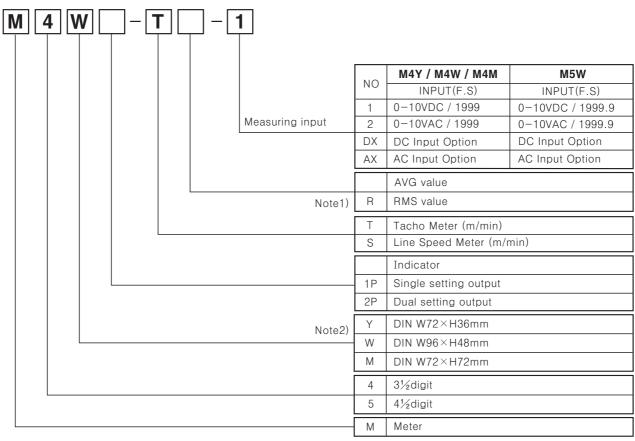

Note1) AC measuring type of M5W only applies to RMS and it is not marked with "R" in the model name. Note2) M4Y, M5W are indicator.

Application of connection

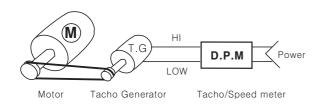

• Tacho Generator (T.G)

This generator makes a voltage in proportion to revoltion speed of motor. The D.P.M receives the voltage and displays the number of revolution and please check the specification of T.G.

●The specification of measuring input indicated in ordering information, is display value when output specification is 0-10VDC and 0-10ADC. Different output specification of tachogenerator is optional.


E-43 Autonics

Digital scaling meter

DIN W72×H36mm, W96×H48mm, W72×H72mm


■ Features

- •Max. display: 19999 (M5W), 1999 (Others)
- •7 Segment LED Display
- •Case size by DIN specification
- •Linear display function by INPUT specification
- •Indicator, Single preset output type, Dual preset output type

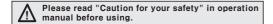

1999

Ordering information

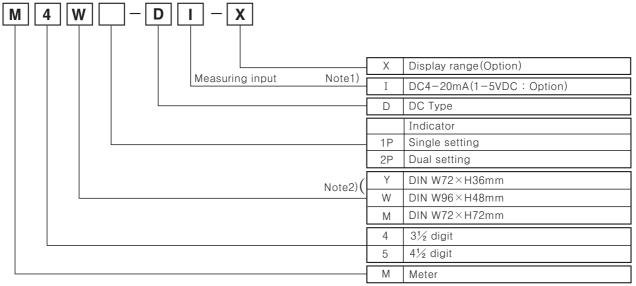


Note1)1-5VDC of measuring input specification is available by option.

It will be a default value if there is no request for order.

Note2)M4Y, M5W are indicator.

Application of connection

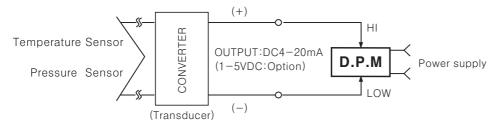

- ●The measurement input specification of ordering information, is an output specification of converter and DC4-20mA is the standard specification. In case, the output of converter is 1-5VDC, it is customizable.
- \bullet DC voltmeter can be produced by requirement, in case, it is out of the 1-5VDC output specification.

(A) Counter

(B) Timer

(C) Temp.

(D) Power controller

(E) Panel meter

(F) Tacho/ Speed/ Pulse meter

(G) Display unit

(H) Sensor controller

(I) Switching power supply

(J) Proximity sensor

(K) Photo electric sensor

(L) Pressure

(M) Rotary encoder

(N) Stepping motor & Driver & Controller

(O) Graphic panel

(P) Field network device

(Q) Production stoppage models & replacement

DIN W96×H48mm, Digital panel meter for display the power factor

■ Features

•Display indicator of power factor


●Input: DC4-20mA(Output specification of power factor transducer)

•Display: $-0.50 \sim 1.00 \sim +0.50$

Please read "Caution for your safety" in operation manual before using.




Ordering information

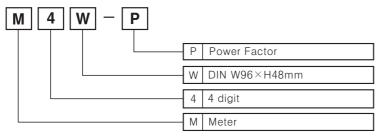


Specifications

| Model | | M4W-P | | |
|-----------------|--------------|--|--|--|
| Measurer | nont | Measuring of power factor(cos ϕ) | | |
| | nent | = | | |
| Input | | DC4-20mA | | |
| Display | | -0.50~1.00~+0.50 cos Ø | | |
| Power su | , | 110/220VAC 50/60Hz | | |
| Allowable range | voltage | 90 ~ 110% of rated voltage | | |
| Power co | nsumption | 4VA | | |
| Display m | nethod | 7 Segment LED Display | | |
| Characte | r height | 14.1mm | | |
| Display a | ccuracy | F · S $\pm 0.5\%$ rdg ± 1 digit | | |
| Sampling period | | 300ms | | |
| Response | e speed | 2sec.(0 ~ Max.) | | |
| Point disp | olay | Fixed point | | |
| Insulation | n resistance | Min. 100MΩ (at 500VDC mega) | | |
| Dielectric | strength | 2000VAC 50/60Hz for 1 minute | | |
| Noise str | ength | ±1kV the square wave noise(pulse width:1μs) by the noise simulator | | |
|) (ila a bi a | Mechanical | 0.75mm amplitude at frequency of 10 ~ 55Hz in each of X, Y, Z directions for 1 hour | | |
| Vibration | Malfunction | 0.5mm amplitude at frequency of 10 ~ 55Hz in each of X, Y, Z directions for 10 minutes | | |
| Shock | Mechanical | 300m/s ² (30G) in X, Y, Z directions for 3 times | | |
| SHOCK | Malfunction | 100m/s ² (10G) in X, Y, Z directions for 3 times | | |
| Ambient | temperature | -10 ~ +50℃ (at non-freezing status) | | |
| Storage t | emperature | -20 ~ +60℃ (at non-freezing status) | | |
| Ambient | numidity | 35~85%RH | | |
| Unit weig | ht | Approx. 317g | | |
| | | | | |


Connections

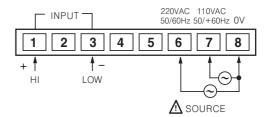

■Application of connection

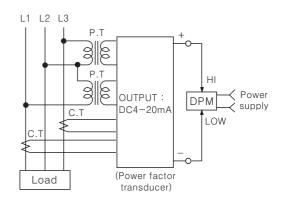

Dimension

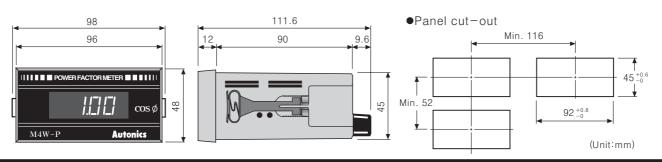

E-45 Autonics